

Wartungsübersicht / Maintenance record

27

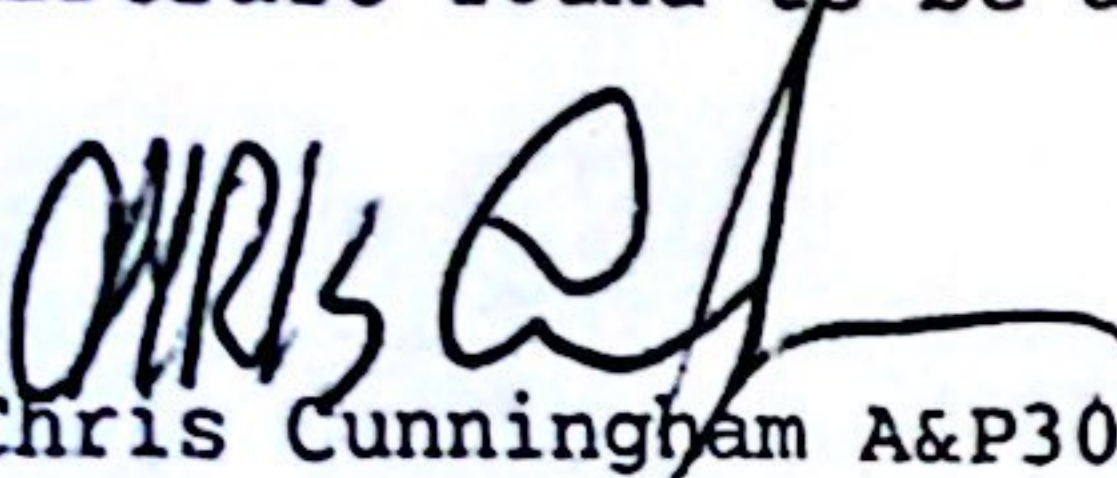
Datum: Date:	Betriebsstunden: Engine hours / cycles:	Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:	
29 Mar 2023	646.1	Reclamped one leaky coolant connection and serviced the coolant overflow reservoir. Serviced the spark plugs and checked the gap. Added 1/2 quart engine oil. ^{Amshell} Sport 4 plus. JJDing AP 3523784.	
1 Apr 23	646.3	Replaced two exhaust springs. Boroscoped cylinders. Looked fine. Leakdown cyl. pressure test results as fol: 1) 79 2) 78 3) 79 4) 77 / 80 performed an annual condition inspection. This engine has been inspected IAW the scope and detail of Appendix D, part 43 and found to be in a condition for safe operation. JJDing AP 3523784	

26

Wartungsübersicht / Maintenance record

Datum: Date:	Betriebsstunden: Engine hours: Gesamt: TSN:	seit letzter GÜ.: TSO:	Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
2021 3 NOV	637.4		Performed an annual condition inspection. A list	
			of unairworthy items was given to the owner dated today. <i>J. J. J. AP 3523784</i>	
10 NOV	637.9		Adjusted RH carb choke + throttle cables after	
			checking slide for freedom of travel. Performed mech + pneumatic carb sync IAW Rotax MM. Good and engine run up to 4000 RPM. <i>J. J. J. AP 3523184</i>	
<u>2023</u> 28 Mar	646.1		Replaced the four pressure side flexible fuel lines from	
			the electric boost pump forward to the carburetors with Gates 4219XL SAE 30R7 50 psi hose. Used this type as the owner uses alcohol blended unleaded auto gas.	
			Czech Sport Aircraft SB-CR-031 was previously not applicable to the removed hoses, nor does it affect the newly installed hoses. Secured new lines with standoffs and leak checked all fuel unions fwd of firewall, IAW	
			maint manual. <i>J. J. J. AP 3523784</i>	

08/16/2017 N767NE Czech Aircraft Sport Cruiser; 582.7 Tach/TTA; s/n 07SC045. Replace exhaust shroud springs. Inspect ELT I/A/W FAR 91.207 (d). Replace batteries. Now due 12/2025. Perform Condition Inspection. Aircraft found to be airworthy and approved for return to service.


Chris Cunningham A&P30386384IA

Wartungsübersicht / Maintenance record

25

Datum: Date:	Betriebsstunden: Engine hours:		Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:		
3 Sept 18 - 2019			Replace Port VLEI EX Spring	Stephen Smith
HORB:	610.5	P.P. 19209969		
8 OCT 20	622.5		Performed an annual condition inspection. A list of unairworthy items was given to the owner this date. Work IAW 43 App D + Rotax.	
			Spud Day AP #3523784.	
8 OCT	622.5		Cleaned air filter IAW Rotax.	
			Stephen Smith 19209969	
2021				
2 NOV	637.4		Performed engine leakdown compression test. Results as follows 1) 78 2) 79 3) 77 4) 79 / 80 Added coolant to the overflow bottle. Serviced spark plugs. Gaps from 0.026 - 0.028. Good.	
				Spud Day AP 3523784.

Wartungsübersicht / Maintenance record

Datum: Date:	Betriebsstunden: Engine hours:		Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:		
	8/14/18		Hobbs 596.4	
	1) Compression 1) 78/80 2) 79/80 3) 78/80 4) 77/80 2) checked spark plugs / Gapped 3) Insp per Rotax Engine 100 hr checklist 4) Run - y leak check ok [Signature] DA 3170123			
13 Sep 2019			Hobbs 610.5 Performed an annual condition inspection, A list of unairworthy items was given to the owner this date. J Friday AP 3523784. Performed oil & filter change, gasculator clean, new plugs gapped 0.027. Compressions greater than 77/80. Ran engine - leak check good. Tipw Rotax 912 u.s.m.	

Wartungsübersicht / Maintenance record

23

Datum: Date:	Betriebsstunden: Engine hours:	Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:	
7/1/16		Hobbs - 565,2	
	<p>1) Compression ① 76/80 ② 77/80 ③ 76/80 ④ 78/80</p> <p>2) Cleaned + gapped spark plugs-</p> <p>3) Completed Rotax Engine 100 hr. Engine Inspection Check list.</p> <p>4) Run up apps + leak check oil</p>		
	<p style="font-size: 1.5em;">Chris</p> <p style="font-size: 1.5em;">3170123</p>		

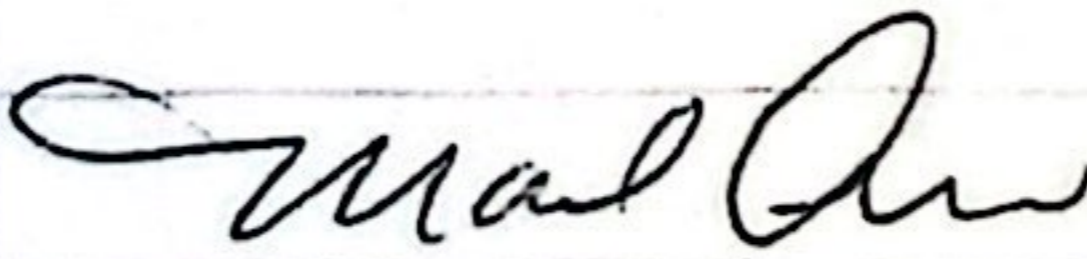
08/16/2017 N767NE Czech Aircraft Sport Cruiser; 582.7 Tach/TTA; s/n 07SC045. Replace exhaust shroud springs. Inspect ELT I/A/W FAR 91.207 (d). Replace batteries. Now due 12/2025. Perform Condition Inspection. Aircraft found to be airworthy and approved for return to service.

Chris

Chris Cunningham A&P30386384IA

22

Wartungsübersicht / Maintenance record

Datum: Date:	Betriebsstunden: Engine hours:		Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:		
5/15/15			Holls 548.9	
			1) Changed oil + filter serviced w/ 3 Aerostell sport plus oil 2) Compression ① 78 ② 76 ③ 77 ④ 78 /so 3) Replaced 2 Exhaust Springs 4) Completed ROTAX Engine Oil in Engine Inspection checklist.	
			 IA 3170123	

Wartungsübersicht / Maintenance record

Datum: Date:	Betriebsstunden: Engine hours:	Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:	

- 1) Changed oil + further service w/
3 gals Aeroshell Sport plus oil
- 2) Replaced 8 sea spruce plugs w/ new
- 3) Compression (1) 76 (2) 75 (3) 75 (4) 74
- 4) Completed ROTAX Engine 100 hr Checklist
STEMS

5) Run-up water check ok

6) Q/W EASA AD

2012-0097 R1
Fuel pump P/N 892542
Installed DNA

7) Replaced 2 sea
Exhaust Springs P/N 938795

I CERTIFY THAT THIS Engine
HAS BEEN INSPECTED IN ACCORDANCE
WITH A CONDITION INSPECTION
AND WAS DETERMINED TO BE IN AN
AIRWORTHY CONDITION.

DATE 2/1/13 TACH TIME 523.7

Mural On IAA 3170

Wartungsübersicht / Maintenance record

Datum: Date:	Betriebsstunden: Engine hours:		Durchgeführte Arbeiten: Work performed:	Unterschrift & LFZ Wart Nr.: Signature & Licence no.:
	Gesamt: TSN:	seit letzter GÜ.: TSO:		
			1) changed oil + filter serviced w/ 3 hrs. of Aeroshell Sport plus oil.	
			2) Replaced ALL 8 Spark plugs w/ new	
			3) Compression ① 76/80 ② 76/80 ③ 78/80 ④ 77/80	
			4) Completed ROTAX Engine Checklist 100 hr.	

Insp. Items.

5) Run-up leak check ok

I CERTIFY THAT THIS ENGINE
HAS BEEN INSPECTED IN ACCORDANCE
WITH A CONDITION INSPECTION
AND WAS DETERMINED TO BE IN AN
AIRWORTHY CONDITION.

DATE 11/1/11 TACH TIME 495.7

Manuel On IDA 3170123